

PIC18F2410/2510/4410/4510 Rev. B4 Silicon Errata

The PIC18F2410/2510/4410/4510 Rev. B4 parts you have received conform functionally to the Device Data Sheet (DS39636D), except for the anomalies described below. Any Data Sheet Clarification issues related to the PIC18F2410/2510/4410/4510 will be reported in a separate Data Sheet errata. Please check the Microchip web site for any existing issues.

The following silicon errata apply only to PIC18F2410/2510/4410/4510 devices with these Device/Revision IDs:

Part Number	Device ID	Revision ID
PIC18F2410	0001 0001 011	0 0111
PIC18F2510	0001 0001 001	0 0111
PIC18F4410	0001 0000 111	0 0111
PIC18F4510	0001 0000 101	0 0111

The Device IDs (DEVID1 and DEVID2) are located at addresses 3FFFFEh:3FFFFFh in the device's configuration space. They are shown in binary in the format "DEVID2 DEVID1".

All of the issues listed here will be addressed in future revisions of the PIC18F2410/2510/4410/4510 silicon.

1. Module: MSSP

In SPI Slave mode with slave select enabled (SSPM<3:0> = 0100), the minimum time between the falling edge of the SS pin and first SCK edge is greater than specified in parameter 70 in Table 25-16 and Table 25-17 of the above referenced data sheet.

The updated specification is shown in bold in Table 1.

Work around

None.


Date Codes that pertain to this issue:

All engineering and production devices.

2. Module: MSSP (SPI Mode)

When the SPI is using Timer2/2 as the clock source, a shorter than expected SCK pulse may occur on the first bit of the transmitted/received data (Figure 1).

FIGURE 1: SCK PULSE VARIATION USING TIMER2/2

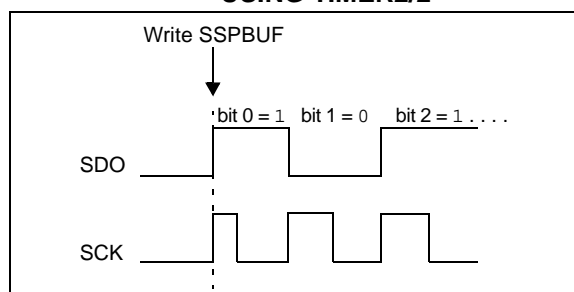

Work around

To avoid producing the short pulse, turn off Timer2 and clear the TMR2 register, load the SSPBUF with the data to transmit and then turn Timer2 back on. Refer to Example 1 for sample code.

EXAMPLE 1: AVOIDING THE INITIAL SHORT SCK PULSE

```

LOOP BTFSS SSPSTAT, BF ;Data received?
      ;(Xmit complete?)
      BRA LOOP ;No
      MOVF SSPBUF, W ;W = SSPBUF
      MOVWF RXDATA ;Save in user RAM
      MOVF TXDATA, W ;W = TXDATA
      BCF T2CON, TMR2ON ;Timer2 off
      CLRF TMR2 ;Clear Timer2
      MOVWF SSPBUF ;Xmit New data
      BSF T2CON, TMR2ON ;Timer2 on
    
```

Date Codes that pertain to this issue:

All engineering and production devices.

TABLE 1: EXAMPLE SPI MODE REQUIREMENTS (SLAVE MODE TIMING)

Param No.	Symbol	Characteristic	Min.	Max.	Units	Conditions
70	TssL2sc, TssL2scl	SS ↓ to SCK ↓ or SCK ↑ Input	3 Tcy	—	ns	

PIC18F2410/2510/4410/4510

3. Module: Enhanced Universal Synchronous Receiver Transmitter (EUSART)

One bit has been added to the BAUDCON register and one bit has been renamed. The added bit is RXDTP and is in the location, BAUDCON<5>. The renamed bit is the TXCKP bit (BAUDCON<4>), which had been named SCKP.

The TXCKP (BAUDCON<4>) and RXDTP (BAUDCON<5>) bits enable the TX and RX signals to be inverted (polarity reversed).

Register 17-3, on page 194, will be changed as shown.

Work around

None required.

Date Codes that pertain to this issue:

All engineering and production devices.

REGISTER 17-3: BAUDCON: BAUD RATE CONTROL REGISTER

R/W-0	R-1	R/W-0	R/W-0	R/W-0	U-0	R/W-0	R/W-0
ABDOVF	RCIDL	RXDTP	TXCKP	BRG16	—	WUE	ABDEN
bit 7							bit 0

Legend:

R = Readable bit	W = Writable bit	U = Unimplemented bit, read as '0'
-n = Value at POR	'1' = Bit is set	'0' = Bit is cleared
		x = Bit is unknown

- bit 7 **ABDOVF:** Auto-Baud Acquisition Rollover Status bit
 1 = A BRG rollover has occurred during Auto-Baud Rate Detect mode (must be cleared in software)
 0 = No BRG rollover has occurred
- bit 6 **RCIDL:** Receive Operation Idle Status bit
 1 = Receive operation is Idle
 0 = Receive operation is Active
- bit 5 **RXDTP:** Receive Data Polarity Select bit
Asynchronous mode:
 1 = Receive data (RX) is inverted. Idle state is a low level.
 0 = No inversion of receive data (RX). Idle state is a high level.
Synchronous mode:
 1 = Data (DT) is inverted. Idle state is a low level.
 0 = No inversion of data (DT). Idle state is a high level.
- bit 4 **TXCKP:** Transmit/Clock Polarity Select bit
Asynchronous mode:
 1 = Transmit data (TX) is inverted. Idle state is a low level.
 0 = No inversion of transmit data (TX). Idle state is a high level.
Synchronous mode:
 1 = Idle state for clock (CK) is a high level
 0 = Idle state for clock (CK) is a low level
- bit 3 **BRG16:** 16-bit Baud Rate Register Enable bit
 1 = 16-bit Baud Rate Generator – SPBRGH and SPBRG
 0 = 8-bit Baud Rate Generator – SPBRG only (Compatible mode); SPBRGH value ignored
- bit 2 **Unimplemented:** Read as '0'

REGISTER 17-3: BAUDCON: BAUD RATE CONTROL REGISTER (CONTINUED)

- bit 1 **WUE:** Wake-up Enable bit
Asynchronous mode:
1 = EUSART will continue to sample the RX pin with the interrupt generated on the falling edge; bit cleared in hardware on following rising edge
0 = RX pin is not monitored or rising edge detected
Synchronous mode:
Unused in this mode.
- bit 0 **ABDEN:** Auto-Baud Detect Enable bit
Asynchronous mode:
1 = Enable baud rate measurement on the next character. Requires reception of a Sync field (55h); cleared in hardware upon completion.
0 = Baud rate measurement disabled or completed
Synchronous mode:
Unused in this mode.

4. Module: 10-Bit Analog-to-Digital Converter

When the AD clock source is selected as 2 TOSC or RC (when $ADCS\langle 2:0 \rangle = 000$ or $x11$), in extremely rare cases, the EIL (Integral Linearity Error) and EDL (Differential Linearity Error) may exceed the data sheet specification at codes 511 and 512 only.

Work around

Select the AD clock source as 4 TOSC, 8 TOSC, 16 TOSC, 32 TOSC or 64 TOSC and avoid selecting 2 TOSC or RC.

Date Codes that pertain to this issue:

All engineering and production devices.

5. Module: MSSP

With MSSP in SPI Master mode, $F_{OSC}/64$ or Timer2/2 clock rate, and $CKE = 0$, a write collision may occur if SSPBUF is loaded immediately after the transfer is complete. A delay may be required after the MSSP Interrupt Flag bit, SSPIF, is set or the Buffer Full bit, BF, is set and before writing SSPBUF. If the delay is insufficiently short, a write collision may occur as indicated by the WCOL bit being set.

Work around

Add a software delay of one SCK period after detecting the completed transfer and prior to updating the SSPBUF contents. Verify the WCOL bit is clear after writing SSPBUF. If the WCOL is set, clear the bit in software and rewrite the SSPBUF register.

Date Codes that pertain to this issue:

All engineering and production devices.

6. Module: Enhanced Capture/Compare/PWM (ECCP)

With the ECCP configured for Half-Bridge PWM mode ($CCP1M\langle 3:0 \rangle = 1110$), the output may be corrupted for particular duty cycle selections. Affected duty cycle values are 0 through 3, and every subsequent increment of 4 (i.e., 7, 11, 15, 19, etc.).

Work around

None.

Date Codes that pertain to this issue:

All engineering and production devices.

PIC18F2410/2510/4410/4510

7. Module: Resets (BOR)

An unexpected Reset may occur if the Brown-out Reset module (BOR) is disabled, and then re-enabled, when the High/Low-Voltage Detection module (HLVD) is not enabled (HLVDCON<4> = 0).

This issue affects BOR modes: BOREN<1:0> = 10 and BOREN<1:0> = 01. In both of these modes, if the BOR module is re-enabled while the device is active, unexpected Resets may be generated.

Work around

If BOR is required, and power consumption is not an issue, use BOREN<1:0> = 11. For BOREN<1:0> = 10 mode, either switch to BOREN<1:0> = 11 mode or enable the HLVD (HLVDCON<4> = 1) prior to entering Sleep.

If power consumption is an issue and low power is desired, Microchip does not recommend using BOREN<1:0> = 10 mode. Instead, use BOREN<1:0> = 01 and follow the steps below when entering and exiting Sleep.

1. Disable BOR by clearing SBOREN (RCON<6> = 0).
2. Enter Sleep mode (if desired).
3. After exiting Sleep mode, enable the HLVD (HLVDCON<4> = 1).
4. Wait for the internal reference voltage (TIRVST) to stabilize (typically 20 μ s).
5. Re-enable BOR by setting SBOREN (RCON<6> = 1).
6. Disable the HLVD by clearing HLVDEN (HLVDCON<4> = 0).

Date Codes that pertain to this issue:

All engineering and production devices.

8. Module: Timer1/3

When Timer1 or Timer3 is operated in Asynchronous External Input mode, unexpected interrupt flag generation may occur if an external clock edge arrives too soon following a firmware write to the TMRxH:TMRxL registers. An unexpected interrupt flag event may also occur when enabling the module or switching from Synchronous to Asynchronous mode.

Work around

This issue only applies when operating the timer in Asynchronous mode. Whenever possible, operate the timer module in Synchronous mode to avoid spurious timer interrupts.

If Asynchronous mode must be used in the application, potential strategies to mitigate the issue may include any of the following:

- Design the firmware so it does not rely on the TMRxIF flag or keep the respective interrupt disabled. The timer still counts normally and does not reset to 0x0000 when the spurious interrupt flag event is generated.
- Design the firmware so that it does not write to the TMRxH:TMRxL registers or does not periodically disable/enable the timer, or switch modes. Reading from the timer does not trigger the spurious interrupt flag events.
- If the firmware must use the timer interrupts and must write to the timer (or disable/enable, or mode switch the timer), implement code to suppress the spurious interrupt event, should it occur. This can be achieved by following the process shown in [Example 2](#).

PIC18F2410/2510/4410/4510

EXAMPLE 2: ASYNCHRONOUS TIMER MODE WORK AROUND TO AVOID SPURIOUS INTERRUPT

```
//Timer1 update procedure in asynchronous mode
//The code below uses Timer1 as example

T1CONbits.TMR1ON = 0;           //Stop timer from incrementing
PIE1bits.TMR1IE = 0;           //Temporarily disable Timer1 interrupt vectoring
TMR1H = 0x00;                   //Update timer value
TMR1L = 0x00;
T1CONbits.TMR1ON = 1;           //Turn on timer

//Now wait at least two full T1CKI periods + 2TCY before re-enabling Timer1 interrupts.
//Depending upon clock edge timing relative to TMR1H/TMR1L firmware write operation,
//a spurious TMR1IF flag event may sometimes assert. If this happens, to suppress
//the actual interrupt vectoring, the TMR1IE bit should be kept clear until
//after the "window of opportunity" (for the spurious interrupt flag event has passed).
//After the window is passed, no further spurious interrupts occur, at least
//until the next timer write (or mode switch/enable event).

while(TMR1L < 0x02);           //Wait for 2 timer increments more than the Updated Timer
                                //value (indicating more than 2 full T1CKI clock periods elapsed)
NOP();                          //Wait two more instruction cycles
NOP();
PIR1bits.TMR1IF = 0;           //Clear TMR1IF flag, in case it was spuriously set
PIE1bits.TMR1IE = 1;           //Now re-enable interrupt vectoring for timer 1
```

PIC18F2410/2510/4410/4510

REVISION HISTORY

Rev A Document (10/2008)

Initial release of this document. Includes silicon issues 1 (MSSP), 2 (MSSP – SPI Mode), 3 (Enhanced Universal Synchronous Receiver Transmitter – EUSART), 4 (10-Bit Analog-to-Digital Converter), 5 (MSSP), 6 (Enhanced Capture/Compare/PWM – ECCP) and 7 (Resets – BOR).

Rev B Document (01/2015)

Added Module 8 (Timer1/3).

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, dsPIC, FlashFlex, flexPWR, JukeBlox, KEELOQ, KEELOQ logo, Klear, LANCheck, MediaLB, MOST, MOST logo, MPLAB, OptoLyzer, PIC, PICSTART, PIC³² logo, RightTouch, SpyNIC, SST, SST Logo, SuperFlash and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

The Embedded Control Solutions Company and mTouch are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, BodyCom, chipKIT, chipKIT logo, CodeGuard, dsPICDEM, dsPICDEM.net, ECAN, In-Circuit Serial Programming, ICSP, Inter-Chip Connectivity, KlearNet, KlearNet logo, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, RightTouch logo, REAL ICE, SQI, Serial Quad I/O, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

Silicon Storage Technology is a registered trademark of Microchip Technology Inc. in other countries.

GestIC is a registered trademarks of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2008-2015, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

ISBN: 978-1-63276-938-1

QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
== ISO/TS 16949 ==

Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC[®] MCUs and dsPIC[®] DSCs, KEELOQ[®] code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



MICROCHIP

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta
Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX
Tel: 512-257-3370

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Cleveland
Independence, OH
Tel: 216-447-0464
Fax: 216-447-0643

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Novi, MI
Tel: 248-848-4000

Houston, TX
Tel: 281-894-5983

Indianapolis
Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608

New York, NY
Tel: 631-435-6000

San Jose, CA
Tel: 408-735-9110

Canada - Toronto
Tel: 905-673-0699
Fax: 905-673-6509

ASIA/PACIFIC

Asia Pacific Office
Suites 3707-14, 37th Floor
Tower 6, The Gateway
Harbour City, Kowloon
Hong Kong
Tel: 852-2943-5100
Fax: 852-2401-3431

Australia - Sydney
Tel: 61-2-9868-6733
Fax: 61-2-9868-6755

China - Beijing
Tel: 86-10-8569-7000
Fax: 86-10-8528-2104

China - Chengdu
Tel: 86-28-8665-5511
Fax: 86-28-8665-7889

China - Chongqing
Tel: 86-23-8980-9588
Fax: 86-23-8980-9500

China - Hangzhou
Tel: 86-571-8792-8115
Fax: 86-571-8792-8116

China - Hong Kong SAR
Tel: 852-2943-5100
Fax: 852-2401-3431

China - Nanjing
Tel: 86-25-8473-2460
Fax: 86-25-8473-2470

China - Qingdao
Tel: 86-532-8502-7355
Fax: 86-532-8502-7205

China - Shanghai
Tel: 86-21-5407-5533
Fax: 86-21-5407-5066

China - Shenyang
Tel: 86-24-2334-2829
Fax: 86-24-2334-2393

China - Shenzhen
Tel: 86-755-8864-2200
Fax: 86-755-8203-1760

China - Wuhan
Tel: 86-27-5980-5300
Fax: 86-27-5980-5118

China - Xian
Tel: 86-29-8833-7252
Fax: 86-29-8833-7256

China - Xiamen
Tel: 86-592-2388138
Fax: 86-592-2388130

China - Zhuhai
Tel: 86-756-3210040
Fax: 86-756-3210049

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444
Fax: 91-80-3090-4123

India - New Delhi
Tel: 91-11-4160-8631
Fax: 91-11-4160-8632

India - Pune
Tel: 91-20-3019-1500

Japan - Osaka
Tel: 81-6-6152-7160
Fax: 81-6-6152-9310

Japan - Tokyo
Tel: 81-3-6880-3770
Fax: 81-3-6880-3771

Korea - Daegu
Tel: 82-53-744-4301
Fax: 82-53-744-4302

Korea - Seoul
Tel: 82-2-554-7200
Fax: 82-2-558-5932 or
82-2-558-5934

Malaysia - Kuala Lumpur
Tel: 60-3-6201-9857
Fax: 60-3-6201-9859

Malaysia - Penang
Tel: 60-4-227-8870
Fax: 60-4-227-4068

Philippines - Manila
Tel: 63-2-634-9065
Fax: 63-2-634-9069

Singapore
Tel: 65-6334-8870
Fax: 65-6334-8850

Taiwan - Hsin Chu
Tel: 886-3-5778-366
Fax: 886-3-5770-955

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600
Fax: 886-2-2508-0102

Thailand - Bangkok
Tel: 66-2-694-1351
Fax: 66-2-694-1350

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Dusseldorf
Tel: 49-2129-3766400

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Pforzheim
Tel: 49-7231-424750

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Venice
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Poland - Warsaw
Tel: 48-22-3325737

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820

03/25/14